X-Ray Tubes

MXRP-160C

Product Description

The MXRP-160C is an unipolar water-cooled tube assembly with integrated radiation protection. It comprises a single focal spot, a tungsten anode and a panoramic beam. The tube is specifically designed for non-destructive imaging applications.

Power rating chart

Power rating at a given filament current

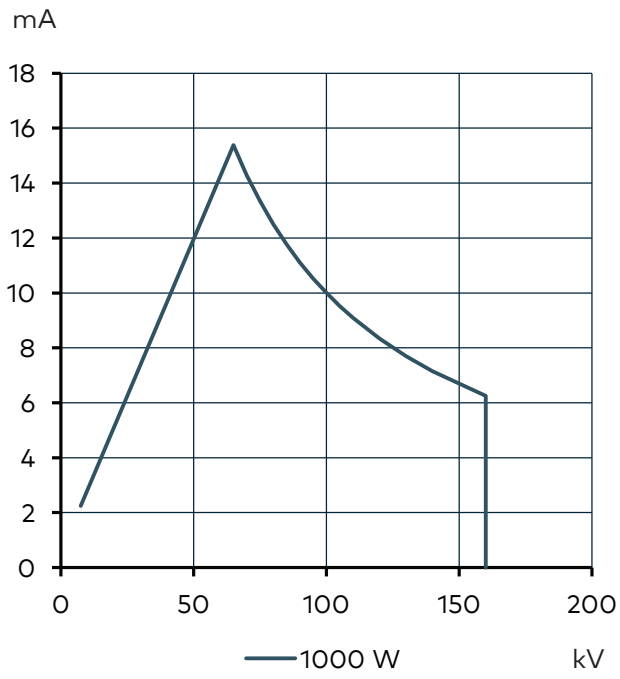

comet
x-ray

Product Specifications

Nominal tube voltage	160 kV
Continuous rating	1000 W
Focal spot acc. to EN12543-2:2008	I = 0.4 mm I w = 4.0 mm
Typical focal spot acc. to ASTM E1165-20[1,2]	I = 0.6 mm I w = 4.0 mm
Typical focal spot class acc. to ASTM E1165-20[1,2]	FS 1-2
Filament current, max	4.2 A
Filament voltage, typical	2.7 V
Inherent filtration	0.5 mm Ti + 2.0 mm H_2O + 2.0 mm Al
Target material	W
Target angle	22°
Radiation coverage	360° x 40°
Leakage radiation, max. at loading factors in 1 m distance	2.5 mSv/h
Weight	6.9 kg
Terminal type	R24
Gapping spring-loaded HV-cable	2 rings visible (~ 7 mm)
Gapping non-spring-loaded HV-cable	5.5 - 6 mm
Grease quantity for HV-cable terminal	1.2 ml
Product No.	915311.51

Cooling

Only use water-based cooling fluid specified by Comet	See Integrator Manual X-Ray Tubes
Cooling medium flow, min.	4 l/min
Cooling medium temp. at inlet, max.	35° C
Pressure at cooling medium inlet, max.	6 bar
Post-cooling time after switchoff, min.	2 min

1 Typical values are provided for reference only and do not represent guaranteed specifications.

2 ASTM E1165-20 and DIN EN ISO 32543-1:2025-12 describe the same focal-spot size measurement procedure.

Comet AG
3175 Flamatt
Switzerland
xray.comet.tech

General Information

General

The control of high-voltage, tube current and filament current as well as the design of the cooling system and the radiation protection are within the responsibility of the original equipment manufacturer (OEM). For detailed instructions always refer to the "X-Ray Tube Manual". Provisions in the generator must assure that the X-Ray tube will be protected against overcurrent, overvoltage and lack of cooling. Otherwise the tube and/or the radiation protection may be damaged and become a hazard.

Radiation protection

When installing an X-ray tube assembly into an X-ray equipment and/or operating an X-ray equipment, the responsibility for radiation protection is with the user. Compliance with local regulatory requirements and limit values must be assured. Do not modify the tube assembly itself!

Connection of the X-ray tube

High-voltage cables must be installed by trained personnel only. Please proceed with the installation as follows: Cleaning, greasing and gapping. Respect the cleanliness, the correct amount of grease and the correct pressure of the plug inside the high-voltage receptacle.

Cooling

The integrator is in charge that the cooling circuit is properly connected to the cooling system. Prior to operating the tube, the cooler must be turned on. Make sure that the coolant flow meets the required cooling conditions and is monitored. If any of the cooling conditions is not met, the high-voltage has to be switched off immediately. When the tube is switched off intentionally, the coolant flow must continue for at least two minutes in order to protect the anode and the lead protection from overheating.

Doc. No. 50005482
© 2026 by Comet AG, Switzerland | V13, 08/2026